Plat of Survey

Being a part of the Southwest fractional quarter (1/4) of Section 30, Township 4 North, Range 5 East, located in the City of Defiance and in Richland Township, Defiance County, Ohio.

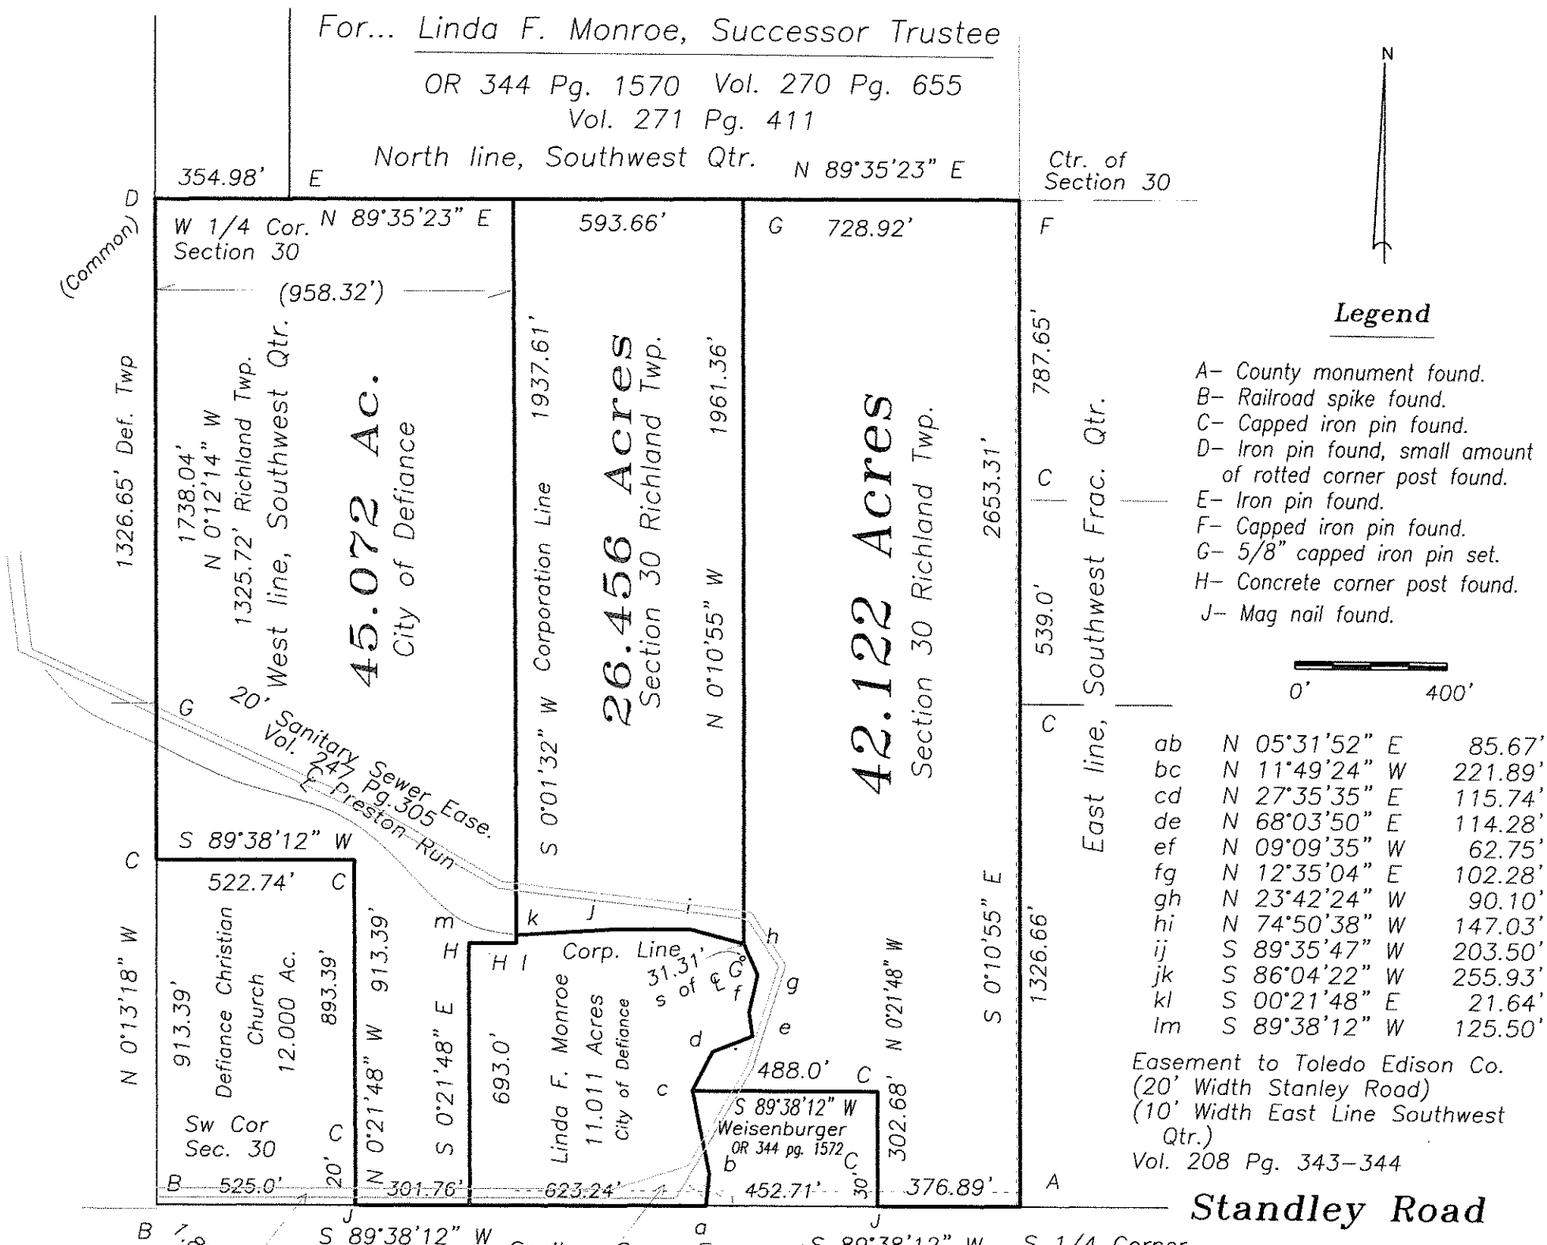

Legend

- A– County monument found.
- B– Railroad spike found.
- C– Capped iron pin found.
- D– Iron pin found, small amount of rotted corner post found.
- E– Iron pin found.
- F– Capped iron pin found.
- G– 5/8" capped iron pin set.
- H– Concrete corner post found.
- J– Mag nail found.

0' 400'

ab	N 05°31'52" E	85.67'
bc	N 11°49'24" W	221.89'
cd	N 27°35'35" E	115.74'
de	N 68°03'50" E	114.28'
ef	N 09°09'35" W	62.75'
fg	N 12°35'04" E	102.28'
gh	N 23°42'24" W	90.10'
hi	N 74°50'38" W	147.03'
ij	S 89°35'47" W	203.50'
jk	S 86°04'22" W	255.93'
kl	S 00°21'48" E	21.64'
lm	S 89°38'12" W	125.50'

Easement to Toledo Edison Co.
(20' Width Stanley Road)
(10' Width East Line Southwest Qtr.)
Vol. 208 Pg. 343–344

Easement to:
The Northwestern Telephone Co.
8' parallel to Road Vol. 165 Pg. 533
The Toledo Edison Co. Vol. 139 Pg. 119
Board of County Commissioners of Defiance County
OR 279 Page 806
The Toledo Edison Co.
Vol. 208 Pg. 347

I hereby certify that I did perform this survey and that it is correct to the best of by knowledge and belief.

3-27-18

Thomas J. Henry
Registered Surveyor No. 6787

STATE OF OHIO
THOMAS HENRY
S-6787
REGISTERED
PROFESSIONAL SURVEYOR

02-30-70