

Plat of Survey

Being a part of the Southwest Quarter ($\frac{1}{4}$) of Section 15, Township 5 North, Range 4 East, Tiffin Township, Defiance County, Ohio.

For... Nellie Ziegler, ETAL

Part of Parcel No.
K14-0015-0-008-00
OR 456 Page 2502

Legend

- A - Iron Pin Found
- B - Harrow Tooth Found
- C - $\frac{5}{8}$ " Iron Pin Found
- D - Stone Found
- E - Railroad Spike Set
- F - Mag Nail Set
- G - $\frac{5}{8}$ " Capped Iron Pin Set
- H - Point Established
- I - Railroad Spike Found

Tiffin River

0.500 Acres
Part of Parcel No.
K14-0015-0-008-00
OR 456 Page 2502

Thomas Henry
K14-0015-0-012-01
DB 214 Page 581

Jacob Graf
K14-0015-0-008-02
OR 472 Page 1386

St. John Cemetery
Parcel No.
K14-0015-0-010-00

Part of Parcel No.
K14-0015-0-008-00
OR 456 Page 2502

Gruber Road

Gares Road

South Line NE 1/4 SW 1/4 Section 15
N 88°51'52" W 1041.51'

Gruber Road

Boundary measurements and bearings:
 - Tiffin River: N 58°31'07" E 48.72'
 - Parcel boundary: S 46°49'56" E 279.46'
 - Parcel boundary: N 43°52'31" E 48.72'
 - Parcel boundary: S 52°50'29" W 112.99'
 - Parcel boundary: N 23°17'23" W 118.54'
 - Parcel boundary: N 40°02'57" W 191.03'
 - Parcel boundary: S 20°16'17" W 61.18'
 - Parcel boundary: S 20°16'17" W 2.28'
 - Parcel boundary: N 88°51'52" W 1041.51'

Points A, B, C, D, E, F, G are marked on the boundaries.

Thomas Henry
K14-0015-0-012-01
DB 214 Page 581

St. John Cemetery
Parcel No.
K14-0015-0-010-00

Part of Parcel No.
K14-0015-0-008-00
OR 456 Page 2502

South Line NE 1/4 SW 1/4 Section 15
N 88°51'52" W 1041.51'


Southeast Corner
NE $\frac{1}{4}$ SW $\frac{1}{4}$
Section 15

2674.28' Southeast Corner
NE $\frac{1}{4}$ SE $\frac{1}{4}$
Section 15

B N 88°54'40" W
South Line N 1/2 SE 1/4 Section 15

Southeast Corner
SE $\frac{1}{4}$
Section 15

Coressel Road

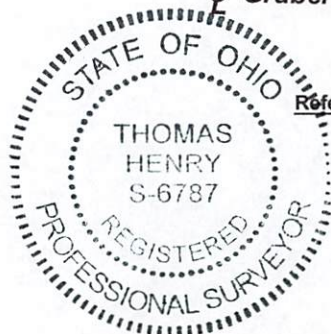

Reference Survey
5-15-15

I hereby declare that I did perform this survey and that it is correct to the best of my knowledge and belief.

12-7-15-26
Thomas J. Henry
Registered Surveyor No. 6787
D 7135